
# 1mm Pitch Cable-to-Board Connectors supporting LVDS signal

### FX15 Series

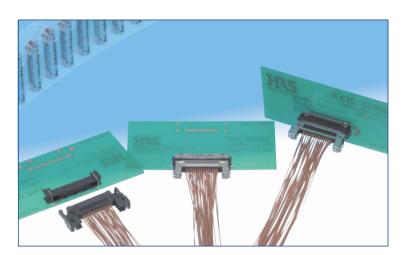

# Patent pending Termination side: 0.5 mm pitch, 1-row construction Mating side: 1 mm pitch, staggered 2-row construction Contacts consolidated into 1 row for equal length transmission lines

### Features

### 1. Space saving

Reduction in space is achieved by designing the contacts in 2-row staggered 1 mm pitch on the mating side and on a single row 0.5 mm pitch on the termination side (Fig. 1).

### 2. Equal length transmission lines

Contact configuration creates equal length transmission lines preventing deterioration of LVDS signal within the connector (Fig.1).

### 3. Different types

Availability of types with or without metal shields allows flexibility of applications and cost reduction.

### 4. Self alignment and self-guiding

Built-in guide posts allow secure self-alignment within  $\pm 1.5$  mm (Fig.2).

### 5. Secure and complete mating / unmating

Side latch-locks assure and confirm complete and secure mating of plugs to receptacles while permitting ease of disconnection (Fig. 3).

### 6. Enhanced shielding effectiveness


Availability of version with enlarged metal shields (preventing intrusion or emission of the electromagnetic interference) further protects the integrity of LVDS signal (FX15S series, Fig.4)


### 7. RoHS compliant


All components and materials comply with the regirements of EU Directive 2002/95/EC.

### Applications

FPD-TV, FPD panels and other applications requiring secure and reliable connection and transmission signal integrity.

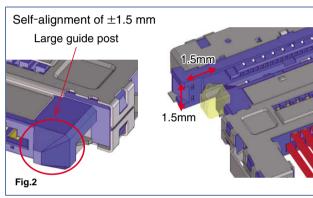

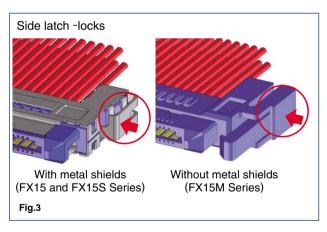

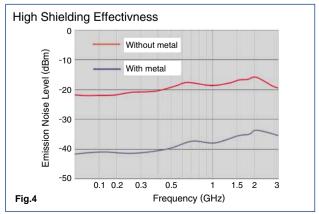

# **■**Product Specifications

Deller	Current rating	0.5A	Operating temperature range	-55℃ to +80℃ (Note 1)
Ratings	Voltage rating	100V AC	Storage temperature range	-10℃ to +60℃ (Note 2)

Item	Specification	Conditions		
Contact resistance	60 m ohms max. (Note 3)	1 mA		
2. Insulation resistance	500 M ohms min.	100V DC		
3. Withstanding voltage	No flashover or insulation breakdown.	300V AC/one minute		
4. Insertion-Extraction force	0.2N min., 30N max.	With corresponding connector		
5. Durability	Contact resistance: 80 m ohms max (Note 3)	50 cycles		
(mating/un-mating)	Contact resistance: 60 m onns max (Note 3)	30 Gydics		
6. Vibration	No electrical discontinuity of 1 $\mu$ s or more.	Frequency: 10 to 55 Hz, single amplitude of 0.76mm, 2 hours, 3 axis		
7. Shock	No electrical discontinuity of 1 $\mu$ s or more.	Acceleration of 490m/s², 11ms durations, sine half-wave waveform, 3 cycles, 3axis.		
8. Humidity	Contact resistance: 80 m ohms max.	96 hours at 40°C, RH 90% to 95%		
	No damage, cracks, or parts dislocation.(Note 3)	90 flouis at 40 C, fil 1 90 % to 93 %		
9. Temperature cycle	Contact resistance: 80 m ohms max. (Note 3)	Temperature : -55°C → +15°C to +35°C → +85°C → +15°C to +35°C		
	Insulation resistance: 500 M ohms min.	Time : $30 \rightarrow 5 \rightarrow 30 \rightarrow 5$ (Minutes) 5 cycles		
10. Calt aprov	Contact resistance: 80 m ohms max. (Note 3)	5% water solution for 48 hours.		
10. Salt spray	No corrosions	5% water solution for 40 nours.		

Note 1: Includes temperature rise caused by current flow.

Note 2: The term "storage" refers to products stored for long period of time prior to mounting and use. Operating temperature range and humidity range covers non-conducting condition of installed connectors in storage, shipment or during transportation.

Note 3: Includes wire conductor resistance (12mm long).

# ■Materials and Finishes

### • Receptacle

Component	Material	Finish	Remarks
Insulator	Polyamide	Color: Black	UL94V-0
Contact	Phosphor bronze	Contact area: Gold plated Termination area: Tin plated	
Metal shields	Nickel silver		
Metal fittings	Phosphor bronze	Selective gold flash plated	

### ●Plug

Component	Material	Finish	Remarks
Insulator	Polyamide	Color: Black	UL94V-0
Contact	Phosphor bronze	Contact area: Gold plated Termination area: Tin plated	
Metal shields	Nickel silver		
Metal latch-locks	Stainless steel		

# **■**Ordering information

•Receptacle


●Plug

$$\frac{FX15}{0} \frac{S}{0} - \frac{31}{6} \frac{P}{0} - \frac{C}{0}$$

Crimp contact

Series Name		: FX15
Configuration	Blank	: With shields (or crimp contact)
	15S	: With shields – enhanced shielding
	15M	: Without shields
3 Number of contacts		
4 Connector type	Р	: Male contact
	S	: Female contact
6 Contact pitch		: 0.5 mm
6 Housing configuration	SH	: Right angle
	SV	: Straight
Termination	С	: Crimp
Applicable conductor	3032	: AWG 30 to 32
Packaging	PCF	: Reel/ plug contact
Plating (contact area)	Α	: Gold plated


# **■FX15 Series – Mating Diagram**

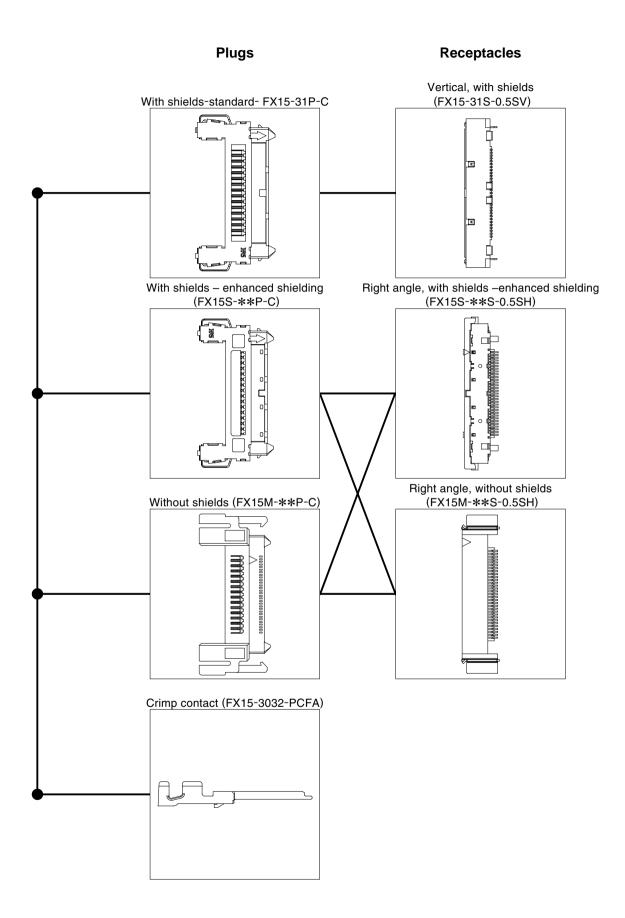

# **■Plugs**

### ●With shields (FX15-31P-C)



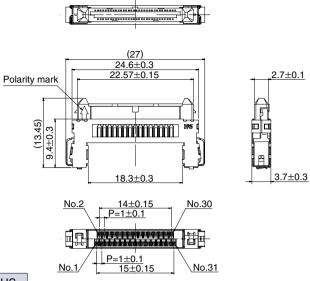


Part number	CL No.	Number of contacts	RoHS
FX15-31P-C	CL575-2101-2	31	YES

Note 1: Packaged in trays.

Note 2: Dimensions in parenthesis ( ) are reference dimensions.

### With shields, enhanced shielding (FX15S-\*\*P-C)



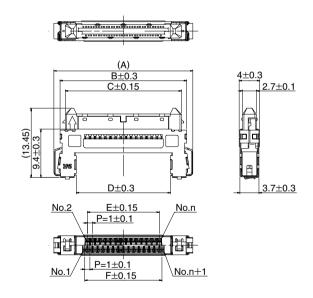


Part number	CL No.	Number of contacts	Α	В	С	D	Е	F	RoHS
FX15S-31P-C	CL575-2106-6	31	27	24.6	22.6	18.3	14	15	
FX15S-41P-C	CL575-2107-9	41	32	29.6	27.6	23.3	19	20	YES
FX15S-51P-C	CL575-2103-8	51	37	34.6	32.6	28.3	24	25	

Note 1: Packaged in trays.

Note 2: Dimensions in parenthesis ( ) are reference dimensions.

### ●Without shields (FX15M-\*\*P-C)



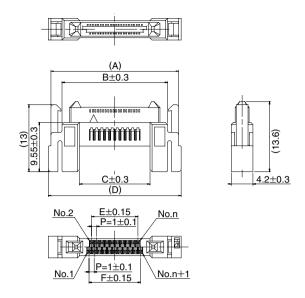

Part number	CL No.	Number of contacts	Α	В	С	D	E	F	G	RoHS
FX15M-21P-C	CL575-2109-4	21	24.8	20.5	17.6	13.7	25.8	9	10	YES
FX15M-31P-C	CL575-2108-1	31	29.8	25.5	22.6	18.7	30.8	14	15	TES

Note 1: Sold in package containing 100 pieces. Order by package.

Note 2: Dimensions in parenthesis ( ) are reference dimensions.

# **■**Plug crimp contacts

Part number	CL No.	Packaging	Quantity	Finish	RoHS
FX15-3032PCFA	CL575-2001-8	Reel	20,000 pieces per reel	Gold plated	YES

### Applicable cable (Tin plated solid soft strands)

Applicable wire size (Stranded wire conductor)	Jacket diameter	UL No.
AWG #30 (7/0.1 mm)	O. From to O. Crown	1516 and 1571
AWG #32 (7/0.08 mm)	0.5mm to 0.6mm	(Note)


### ●Wire strip length: 1.2 to 1.9 mm

Note: Refer to crimp condition sheet.

### **●**Tools

Item	Product number	CL No.
Applicator	AP105-FX15-3032	901-4033-1
Press unit	CM-105	901-0005-4


Note: Only HRS tools must be used.

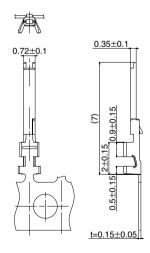


# **■**Receptacles

### ●Vertical, with shields (FX15-31S-0.5SV)




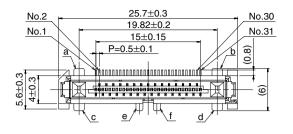



Part number	CL No.	Number of contacts	RoHS
FX15-31S-0.5SV	CL575-2201-7	31	YES


# ♠ Recommended PCB mounting pattern and metal mask dimensions

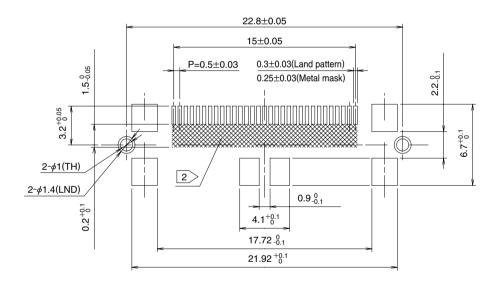



Note 1 :The co-planarity of the terminal leads is as follows:

- · All signals and shield leads "c" and "d": 0.1mm max.
- · Shield leads "a", "b", "e" and "f": 0.15 mm max.
- 2: Area indicated by the crosshatched lines must be free of conductive traces or the conductive traces must be covered by resist film.
- 3 : Packaged on tape-and-reel, 1000 pieces per reel.
- 4 : Dimensions in parenthesis ( ) are reference dimensions.

### ●Right angle with shields –enhanced shielding (FX15S-\*\*S-0.5SH)

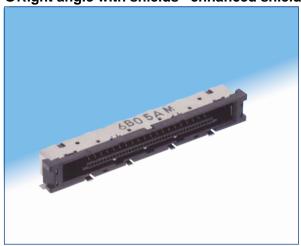


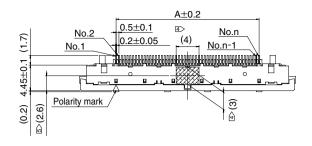

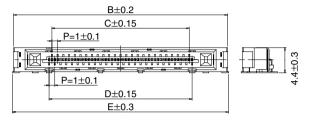

Part number	HRS No.	Number of contacts	Α	В	С	D	Е	F	G	Н	
Tarriamber	111101110.	Trainber of contacts							ч		-
FX15S-31S-0.5SH	CL575-2306-5	31	15	27.4	14	15	27.8	28.8	24.8	21.6	
FX15S-41S-0.5SH	CL575-2307-8	41	20	32.4	19	20	32.8	33.8	29.8	26.6	
FX15S-51S-0.5SH	CL575-2303-7	51	25	37.4	24	25	37.8	38.8	34.8	31.6	
			J	K	L	М	N	Р	R	S	RoHS
		Л	18	15			13.2	16.8	24.8	40	
			23	20	5.2	8.8	18.2	21.8	29.8	45	YES
			28	25	5.2	8.8	23.2	26.8	34.8	50	


# ♠ Recommended PCB mounting pattern and metal mask dimensions

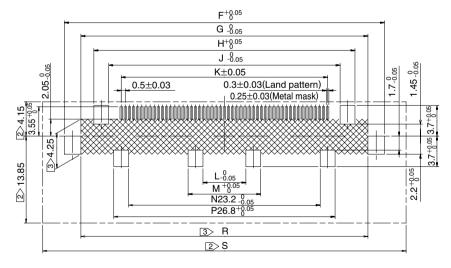


- Note 1: The coplanarity of the terminal leads is 0.1 mm max. for all signal leads and 0.15 mm max. for the shield leads.
  - 2: Do not place any components in the area indicated. Placement of components in this area may affect mating and latch lock operation.
  - 3>: Area indicated by the cross-hatched lines must be free of conductive traces or the conductive traces must be covered by resist film.
  - 4): The area marked additional indicates vacuum pick-and-place area for board placement with automatic equipment.
  - 5>: Vacuum pick-up area
  - 6 : Packaged on tape-and-reel, 1000 pieces per reel.
  - 7 : Dimensions in parenthesis ( ) are reference dimensions.


### ●Right angle, without shields (FX15M-\*\*S-0.5SH)



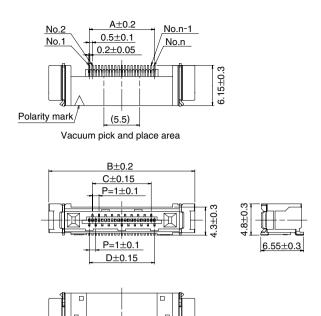



# ♠ Recommended PCB mounting pattern and metal mask dimensions

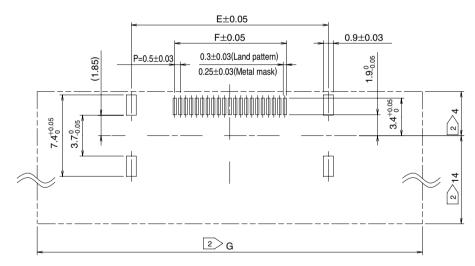


Note 1: The co-planarity of all terminal leads is 0.1 mm max.

- 2: Do not place any components in the area indicated. Placement of components in this area may affect mating and latch lock operation.
- 3 : Packaged on tape-and-reel, 1000 pieces per reel.

# **■**Packaging Specifications


## ●Vertical, with shields- (FX15-31S-0.5SV)

Part number	HRS No.	Number of contacts	D
FX15-31S-0.5SV	CL575-2201-7	31	44.5

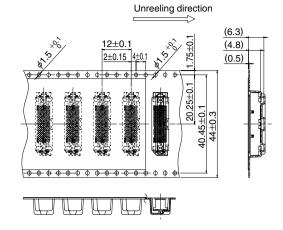


### ●Right angle, with shields-enhanced shielding (FX15S-\*\*S-0.5SH)

Part number	HRS No.	Number of contacts	Α	В	С	D
FX15S-31S-0.5SH	CL575-2306-5	31	20.3	40.5	44	44.5
FX15S-41S-0.5SH	CL575-2307-8	41	26.3	52.5	56	56.5
FX15S-51S-0.5SH	CL575-2303-7	51	26.3	52.5	56	56.5

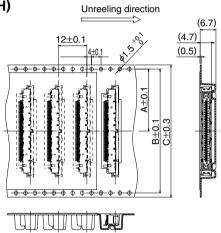



### ●Right angle, without shields (FX15M-\*\*S-0.5SH)

Part number	HRS No.	Number of contacts	Α	В	С	D
FX15M-21S-0.5SH	CL575-2309-3	21	20.2	40.4	44	44.5
FX15M-31S-0.5SH	CL575-2308-0	31	20.2	40.4	44	44.5

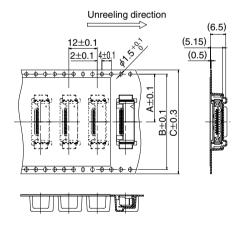


### ● Reel dimensions

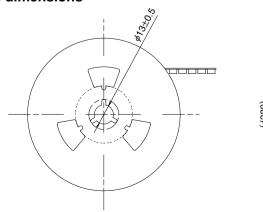



# 

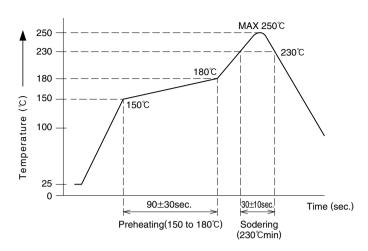

### **HRS** test conditions

Test boardGlass epoxy 40mm×30mm×1mm thick

Solder method :Reflow Solder composition :Paste.

96.5%Sn/3%Aq/0.5%Cu

Metal mask : 0.12mm thick Reflow cycles : 2 cycles

The temperature profile is based on the above conditions.

In individual applications the actual temperature may vary, depending on solder paste type,

volume/thickness and board size/thickness. Consult your solder paste and equipment manufacturer for specific recommendations.

# Cleaning recommendations

### Organic solvent cleaning


Solvent type	Room temperature cleaning	Heated cleaning		
IPA (Isoporopyl alcohol)	YES	YES		
HCFC (Hydrochlorofluorocarbon)	YES	YES		


### Water based cleaning

When using water based cleaning agents (e.g., terpene, alkali saponifiers), select the cleaning agent based on the documentation issued by the various manufacturers of cleaning agents which describes it's affects on metals, platings and plastics. Remove any moisture after cleaning. Residual flux or cleaning agents in the contact areas may affect electrical performance.

# **● Technical Information (FX15S Series)**

### ●Eye Pattern Waveforms (700 MHz)

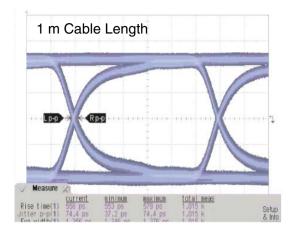


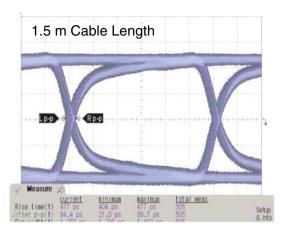

### Shielding Effectiveness (Shielding Characteristics Comparison Using a 2-chamber Shielded Room)

Measured shielding effectiveness for frequencies from 100 MHz to 2 GHz.

Shielded connectors show noise suppression of 10 db to 20 dB, when compared with connectors without the shields.

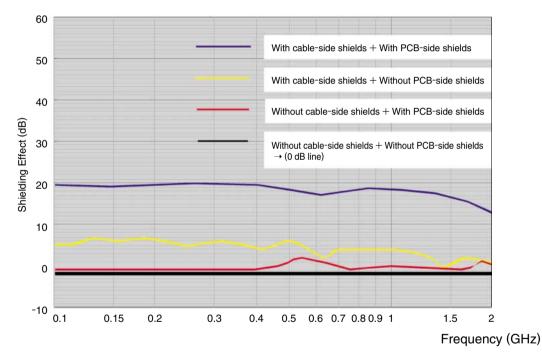

Notes:The measurement value of "Without plug-side shields + Without receptacle-side shields" are taken as the zero level of the graph vertical axis dB.

The respective results express the noise suppression effect (dB) as a relative comparison value with this "without shields" condition as the reference.

### **Precautions and recommendations**

### ♦Wire termination

The following documents will be needed in order to perform the cable terminations.


- (1) Basic cable termination and crimp requirements (general explanations).
- ②Contact crimp termination machine instruction manual (Explanation of the press)
- 3 Applicator parts installation table (Applicator installation explanation)
- 4 Crimp conditions table (Crimp height/Tensile strength standard values)
- ⑤Crimp quality fundamentals manual (Bell-mouth dimensions, bent up, bent down, rolling, etc.)
- \* Correct cable preparation and crimp termination is based on understanding and following the procedures in the above documents.

### ◆Insertion of the crimp contacts in the housing


Crimp contacts are inserted in the housing as illustrated below.

Exercising caution when inserting, align the retention tab of the contact with the corresponding molded-in lance in the housing's contact cavity and push the contacts in.

Make sure that the contact is fully inserted and the retention tab clears the molded-in lance.

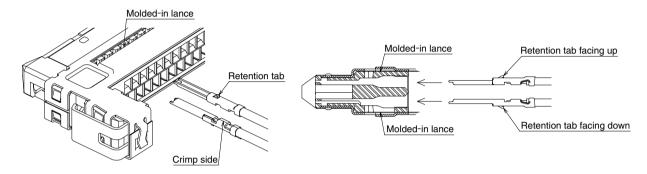

♦ Verify that the retention tabs clear the molded-in lances as shown on the illustration below.

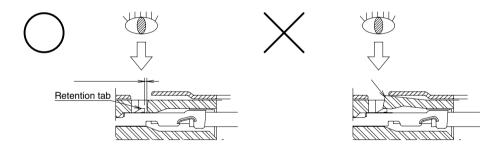


Light pull on the wire, with force NOT EXCEEDING 3N will also verify the correct contact insertion.

### ◆Removal of the contacts

Using sharp-pointed tool of appropriate size gently lift the molded-in tab and pull-out the terminated contacts.

Excersize caution as NOT to damage the molded-in lance.

Should the damage occur, the entire housing will need to be replaced.




### **Precautions and recommendations**

### ◆Packaging of the complete cable assemblies

Exercise caution as not to tangle, twist or deform the complete cable assemblies when packaging. Special care should be taken NOT to apply any excessive pull forces to the individual wires.


When removing the cable assemblies from the packaging do not pull on the wires. Make sure that the latch-locks are not interfering with packaging.




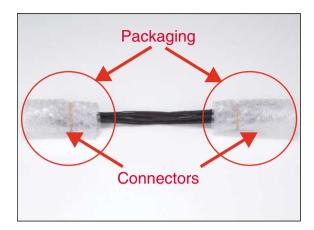

### ◆Mating of the connectors

The connectors have built-in polarizing feature and will NOT mate when reversed. Do NOT try forced mating. Align the connectors as shown on the illustration below and fully insert the plug into the receptacle. Confirm that both latch-locks are fully engaged.

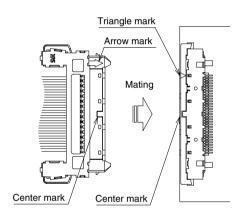

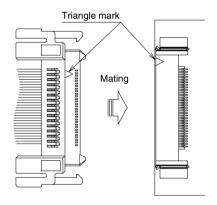

### **Precautions and recommendations**


### ◆Handling of Connectors after Mating

Do not to apply excessive forces to the connectors when routing the cable after mating.


Pulling on the entire cable with a force of 20 N or greater can damage the connector. Please take due care not to pull the cable.


### ◆Un-mating of the connectors

Depress equally both sides of the latch-locks as shown on the illustration and pull the plug straight out. Do not pull on the cables!

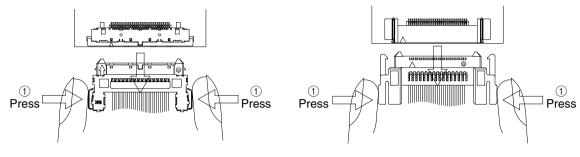

### 2 Pull straight apart

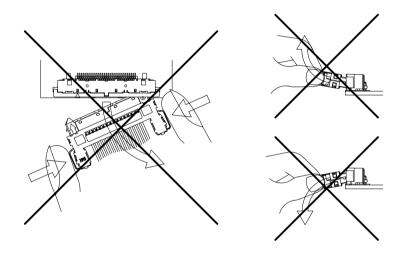

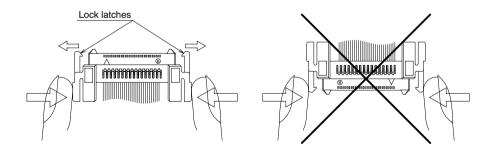

### **Precautions and recommendations**

[ Soldering precautions related to FX15S-\*\*P-C connectors ]

- ◆Grounding Methods of the ground wire or shields for the cable assemblies
- ①Solder the ground wire or the shields ONLY in the areas specifically designated for this purpose, as shown on the illustrations below.
- ②Observe the soldering iron tip temperature and soldering time specified.
- ③Do not apply excessive force to the connector by pressing it with the tip of a soldering iron.
- 4)Do not splatter the flux from the solder core.

